

Calorimetric Flow Meter, Monitor, Totalizer



measuring • monitoring • analysing



KOBOLD Messring GmbH Nordring 22-24 D-65719 Hofheim/Ts. 3 +49(0)6192 299-0 Fax +49(0)6192 23398 E-Mail: info.de@kobold.com Internet: www.kobold.com Model: DVK





Description

The digital KOBOLD flow meter/monitor model DVK serves to measure and monitor small and average flows of air in piping and hoses.

The device is absolutely maintenance-free and uses the calorimetric method. When the operating voltage is applied, a thermistor integrated in the sensor is heated to a defined value above the medium temperature. When air (or gas) flows through the sensor, the heat generated in the sensor is absorbed by the medium. This means that the sensor is cooled down to the medium temperature. Depending on the velocity and rate of flow, the temperatures are equalized and the resistance of the sensor is reduced proportionally. The flow velocity can be determined by measuring the resistance. The medium temperature is measured by a second sensor.

The resistance values of both sensors are compared by the electronics over a Wheatstone bridge circuit and an output relay is actuated if the set switching values has not been made or exceeded. The switch state is signalled by two LEDs (ON: LED on; OUT 1*: green, OUT 2*: red).

The digital KOBOLD flow meter type DVK works with practically no pressure loss.

Typically, the device is available in two different versions (display and sensor as compact instrument, or display and sensor separated but connected with a cable) with the necessary screw connections.

* The two outputs OUT 1 and OUT 2 can only be activated by flow measurement per unit of time, and not by totalizing.

Areas of Application

- flow monitoring of air and gases
- in air conditioning systems
- in extraction systems

Technical details

Method of measurement: calorimetric principle

Mounting position: Measuring ranges:	any, flow in direction of arrow 110 L/min; 10100 L/min (switchable to CFMx 10 ⁻² x); 20200 L/min; 550 L/min; 50500 L/min (switchable to CFMx 10 ⁻¹) 1503000 L/min; 3006000 L/min; 60012000 L/min Air at 0°C; 1013 mbar or 20°C; 1013 mbar
Accuracy:	±5% f.s.
Repeatability:	±1% f.s. (DVK01/DVK05) ±2% f.s. (other types)
Temperat. characteristic:	± 3% f.s. (15 - 35°C) ± 5% f.s. (0 - 50°C)
Operating pressure:	-0.5+5.0 bar (DVK01/DVK05) testing pressure 10 bar
	-0.5+7.5 bar (DVK10/20/50) testing pressure 10 bar
	1,515 bar (DVK70 / 80 / 90) testing pressure 22,5 bar

Pressure loss at full scale: see table Operating temperature: 0...50°C Material: connections: ADC ≙ aluminium die casting sensor and housing: PBT / PPS/Lead-glass/Ptlr/FeNi/OFC Sieve: Stainless steel Gasket: NBR Response time: 1sConnections: G 1/4, G 3/8, G 1/2; G 1, G 1 1/2, G 2 3-digit 7-segment-LCD, Display 90° rotatable Totalizing: 0...999999 (litres or ft³ x 10⁻¹), resettable Supply: 12...24 V_{DC}, max. 170 mA Outputs: 2 x PNP open collector, 80 mA, 4 - 20 mA analogue output, load max. 250 Ω Switching indication: 2 x LED (OUT 1: green, OUT 2: red) Minimum switching 0.5% of max. range value adjustment: Hysteresis: adjustable Shock resistance: 490 m/s² in X-, Y-, and Z-direction (3 x each direction) Vibration resistance: 10...500 Hz at amplitude < 1.5 mm or acceleration of 98 m/s² in X-, Y-, Z-direction (2 hours per direction) Protection: IP 65 Weight: < 290 g (without connecting lead) $(G \frac{1}{4} / G \frac{3}{8} / G \frac{1}{2})$ 1.1 kg (G 1); 1.3 kg (G 1¹/₂); 2.0 kg (G 2)



Order details (example: DVK-12 01R08)

Description	Model	Measuring range/connection	Output	
Flow meter compact version	DVK-12			
Flow meter sensor unit*	DVK-22	01R08 = 1-10 L/min air, G ¹ /4 05R08 = 5-50 L/min air, G ¹ /4 10R10 = 10, 100 L/min air, G ³ /4	3PP = 2 x PNP	
Display unit for DVK-22 DIN-rail, wall mounting	DVK-32	10R10 = 10-100 L/min air, G % 20R10 = 20-200 L/min air, G % 50R15 = 50-500 L/min air, G ½	switching outputs	
Display unit for DVK-22 panel mounting	DVK-42			
Flow meter compact version	DVK-12	70R25 = 150-3000 L/min air, G 1 80R40 = 300-6000 L/min air, G 1 ¹ / ₂ 90R50 = 600-12 000 L/min air, G 2	3P4 = 1 x PNP switching output and 4-20 mA analogue output	

*A display unit DVK-32 or DVK-42 is required for the sensor unit DVK-22.

Accessories: electrical connection


Description	Model
M12x1 box with 2 m cable	ZUB-KAB-12K002
M12x1 box with Quickon-connector	ZUB-KAB-12Q000

Pressure loss

Model	DVK01	DVK05	DVK10	DVK20	DVK50	DVK70	DVK80	DVK90
ME [L/min]	10	50	100	200	500	3000	6000	12 000
Pressure loss [mbar]	12	30	100	200	450	200	200	200



Dimensions

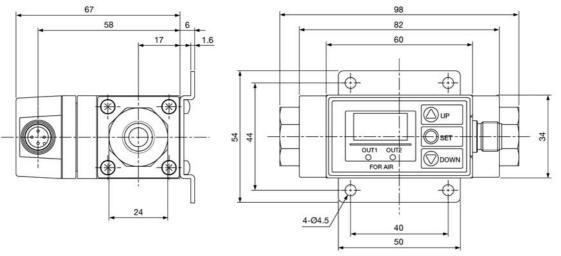


42

Electrical connection

Pin numbers

Numbers	Pin name
1	DC (+)
2	OUT 2 / analogue output
3	DC (-)
4	OUT 1



Display unit

